


Ultrasonic sensor UC2000-L2-I-V15


- Sensor head bidirectional and rotatable
- Function indicators visible from all directions
- Quick mounting bracket
- Selectable sound lobe width
- Programmable

Single head system



Dimensions

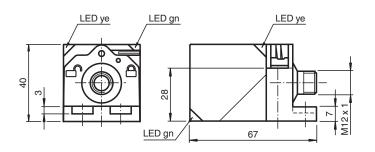

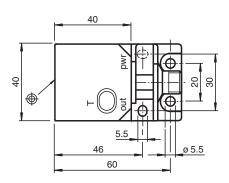

Technical Data

General specifications		
Sensing range		60 2000 mm
Adjustment range		80 2000 mm
Dead band		0 60 mm
Standard target plate		100 mm x 100 mm
Transducer frequency		approx. 175 kHz
Nominal ratings		
Response delay		minimum: 60 ms factory setting: 330 ms
Time delay before availability	t _v	≤ 1600 ms

Refer to "General Notes Relating to Pepperl+Fuchs Product Information"

Pepperl+Fuchs Group www.pepperl-fuchs.com USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com



Technical Data

Indicators/operating means		
LED green		Operating display
LED yellow		object in evaluation range
LED red		error
Electrical specifications		
Operating voltage	UB	10 30 V DC , ripple 10 %ss
No-load supply current	I ₀	≤ 50 mA
Interface	10	2001111
Interface type		Serial interface (programming adapter required) 9600 BPS, no parity, 8 data bits, 1 stop bit
Input/Output		
Input/output type		1 synchronization connection, bidirectional
0 Level		0 1 V
1 Level		4 V U _B
Input impedance		> 12 kΩ
Output rated operating current		< 12 mA
Pulse length		0.5 300 ms (level 1)
Pulse interval		\geq 33 ms (level 0)
Synchronization frequency		
Common mode operation		≤ 30 Hz
Multiplex operation		\leq 33 Hz / n , n = number of sensors , n \leq 10 (factory setting: n = 5)
Input		
Input type		1 program input
Level (evaluation limit 1)		01V
Level (evaluation limit 2)		4 V U _B
Input impedance		> 12 kΩ
Pulse length		2 10 s
Output		
Output type		1 analog output 4 20 mA
Resolution		Evaluation range [mm]/3200, however ≥ 0.4 mm
Deviation of the characteristic curve		\leq 0.2 % of full-scale value
Repeat accuracy		\leq 0.1 % of full-scale value
Load impedance		\leq 500 Ω at U _B \geq 14V \leq 300 Ω at U _B $<$ 14V
Temperature influence		\leq 1.5 % of full-scale value
Compliance with standards and directives		
Standard conformity		
Standards		EN IEC 60947-5-2:2020 IEC 60947-5-2:2019 EN 60947-5-7:2003 IEC 60947-5-7:2003
Approvals and certificates		
UL approval		cULus Listed, General Purpose
CCC approval		CCC approval / marking not required for products rated \leq 36 V
Ambient conditions		
Ambient temperature		-25 70 °C (-13 158 °F)
Storage temperature		-40 85 °C (-40 185 °F)
Mechanical specifications		
Connection type		Connector plug M12 x 1 , 5-pin
Degree of protection		IP67
Material		
Housing		PA-GF35
Transducer		epoxy resin/hollow glass sphere mixture; polyurethane foam


Refer to "General Notes Relating to Pepperl+Fuchs Product Information".

Germany: +49 621 776 1111 fa-info@de.pepperl-fuchs.com Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com

Technical Data

Factory settings	
Output	evaluation limit A1: 80 mm evaluation limit A2: 2000 mm output function: rising ramp
Beam width	wide
Evaluation procedure	low-pass behavior
General information	
Supplementary information	Switch settings of the external programming adapter: "output load": pull-down "output logic": noninv

Connection



Connection Assignment




Wire colors in accordance with EN 60947-5-2

1	BN	(brown)
2	WH	(white)
3	BU	(blue)
4	BK	(black)
5	GY	(gray)

Characteristic Curve

Characteristic response curve

Distance Y [mm]

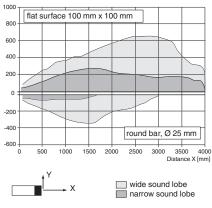

Refer to "General Notes Relating to Pepperl+Fuchs Product Information"

Acces	Accessories			
a - 4	UC-PROG1-USB	Programming adapter		
ø /	V15-G-2M-PVC	Female cordset single-ended M12 straight A-coded, 5-pin, PVC cable grey		
0,1	UB-PROG2	Programming unit		
	Microsoft .NET	Connection Software		

Refer to "General Notes Relating to Pepperl+Fuchs Product Information"

Programming

Programming the sensor functions

The sensor features an analog output with two programmable limit values. The limit values and output operating modes can be programmed in three different ways:

- Using the programming key on the sensor
- By activating the 0-V or +U_B supply voltage on the programming input (for programming the limit values only)
- Using the serial interface on the sensor. This method requires an external interface module.

The programming methods using the programming key and programming input are described below. To use the serial interface on the sensor for programming, see the software description. The processes for programming the limit values and the sensor operating modes run completely independently and do not influence one another.

Notes:

- The sensor can only be programmed during the first 5 minutes after switching on. This time is extended during the actual programming process. The option of programming the sensor is revoked if no programming activities take place for 5 minutes.
- Programming can be aborted at any time during the process, without changing the sensor settings. To do so, press and hold the programming key for 10 seconds.

Programming the limit value of the analog characteristic

Note

A flashing red LED during the programming process indicates unreliable object detection. Should this occur, correct the alignment of the object until the yellow LED flashes. Only then will the settings be transferred to the sensor memory.

Programming the limit values using the programming key

Programming the near characteristic limit value

- 1. Position the object at the site of the required near limit value
- 2. Press and hold the programming key for 2 seconds (yellow LED flashes)
- 3. Briefly press the programming key (green LED flashes 3 times as confirmation). The sensor returns to normal mode.

Programming the distant characteristic limit value

- 1. Position the object at the site of the required distant limit value
- 2. Press and hold the programming key for 2 seconds (yellow LED flashes)
- 3. Press and hold the programming key for 2 seconds (green LED flashes 3 times as confirmation). The sensor returns to normal mode.

Programming the limit values using the programming input

Notes:

- Before starting the programming process, the programming input must be disconnected for at least 2 seconds.
- If the operating voltage (0 V or +U_B) is applied for >10 seconds, the sensor returns to normal mode without changing the settings. To ensure
 that programming is successful, disconnect the programming input before this time elapses.
- If the programming input is not used, it should be permanently connected at 0 V.
- If programming adapter UB-PROG2 is used for the programming process, the "A1" key is equivalent to 0 V and "A2" to +U_B. In this case, ensure that the wire that is connected to the programming input is open at the end of the sensor cable (not clamped at potential).

Programming the near characteristic limit value

- 1. Position the object at the site of the required near limit value
- 2. Connect the programming input to 0 V for 2 seconds (yellow LED flashes, then the green LED flashes three times as confirmation). The sensor then returns to normal mode.

Programming the distant characteristic limit value

- 1. Position the object at the site of the required distant limit value
- 2. Connect the programming input to +U_B for 2 seconds (yellow LED flashes, then the green LED flashes three times as confirmation). The sensor then returns to normal mode.

Programming the sensor operating modes

The sensor features a two-stage process for programming the sensor operating modes. During this process, you can program:

- 1. The curve of the analog characteristic
- 2. The shape of the sound cone

These two stages of the process are programmed in succession. To switch from one programming function to the next, press and hold the programming key for 2 seconds.

Press and hold the programming key for 5 seconds to switch to the process for programming the sensor operating modes.

Programming the curve of the analog characteristic

- 1. The green LED is now flashing. The number of flashes indicates the output function currently programmed:
 - 1x: rising ramp

www.pepperl-fuchs.com

- 2x: falling ramp
- 3x: zero-point line
- 2. Briefly press the programming key to switch between the different curves and press again to select the required curve.

fa-info@de.pepperl-fuchs.com

3. Press and hold the programming key for 2 seconds to save the selection and switch to the process for programming the sound cone.

Singapore: +65 6779 9091

fa-info@sg.pepperl-fuchs.com

eng.pdf

fa-info@us.pepperl-fuchs.com

Ultrasonic sensor

Programming the shape of the sound cone

- The red LED is now flashing. The number of flashes indicates the sound cone shape currently programmed: 1x: narrow 2x: medium
 - 3x: wide
- 2. Briefly press the programming key to navigate through the different sound cone shapes in succession and press again to select the required sound cone shape.
- 3. Press and hold the programming key for 2 seconds to save the selection and return to normal mode.

Factory Setting

Reset Sensor to Factory Settings

The sensor has a feature to reset to factory settings

- 1. Disconnect the sensor from power supply
- 2. Press and hold the Programming Button
- 3. Connect Sensor to power supply (yellow and red LED flash simultaneously for 5 s then yellow and green LED flash simultaneously)
- 4. Release Programming Button

The sensor now operates with default factory settings.

Factory settings

See technical data.

Indication

The sensor features three LEDs for indicating statuses.

	Green LED	Yellow LED	Red LED
In normal mode			
Fault-free function	On	Object in the analog characteristic range	Off
Fault (e.g. compressed air)	Off	retains previous status	On
When programming the limit values			
Object detected	Off	Flashing	Off
No object detected	Off	Off	Flashing
Confirmation of successful programming	Flashing 3x	Off	Off
Warning in the event of invalid programming	Off	Off	Flashing 3x
When programming the operating mode			
Programming the output function	Flashing	Off	Off
Programming the sound cone	Off	Off	Flashing

Commissioning

Synchronization

This sensor features a synchronization input for suppressing ultrasonic mutual interference ("cross talk"). If this input is not connected, the sensor will operate freewheeling using internally generated clock pulses. It can be synchronized by applying an external square wave or by means of appropriate programming via the serial interface. Each falling edge of the synchronization pulse triggers transmission of a single ultrasonic pulse. If the synchronization signal remains low for \geq 1 second, the sensor will revert to normal operating mode. Normal operating mode can also be activated by opening the signal connection to the synchronization input.(See note below)

If the synchronization input goes to a high level for > 1 second, the sensor will switch to standby mode, indicated by the green LED. In this mode, the output(s) will remain in the last valid output state. When using the external synchronization feature, please refer to the software description.

Note:

If the option for synchronization is not used, the synchronization input has to be connected to ground (0V) or the sensor has to be operated via a V1 cordset (4-pin).

The synchronization function cannot be activated during programming mode and vice versa.

The following synchronization modes are possible:

- 1. Several sensors (max. number see technical data) can be synchronized together by interconnecting their respective synchronization inputs. In this case, each sensor alternately transmits ultrasonic pulses in a self multiplexing mode. No two sensors will transmit pulses at the same time. (See note below)
- 2. Several sensors (max. number see technical data) can be synchronized together by interconnecting their respective synchronization inputs. Due to programming via the sensors interface one sensor acts as a master device, all the others as slave devices. (see description of the interface) In this master / slave mode the sensors are triggered in parallel and are synchronized by a common synchronization pulse, provided by the master device.
- 3. Multiple sensors can be controlled by the same external synchronization signal. In this mode the sensors are triggered in parallel and are synchronized by a common external synchronization pulse. All sensors must be parameterized for external synchronization by means of the sensor interface. See software description.
- 4. A separate synchronization pulse can be sent to each individual sensor. In this mode the sensors operate in external multiplex mode. (See note below). All sensors must be parameterized for external synchronization by means of the sensor interface. See software description.
- 5. A high level (+U_B) or a low level (-U_B)on the synchronization input switches the sensor to standby mode if it is parameterized for external synchronization.

Note:

Refer to "General Notes Relating to Pepperl+Fuchs Product Information



Ultrasonic sensor

Sensor response times will increase proportionally to the number of sensors that are in the synchronization string. This is a result of the multiplexing of the ultrasonic transmit and receive signal and the resulting increase in the measurement cycle time.

Note:

The sensors syncronization input delivers an output current in case of low level and burdens with its input impedance in case of high level. Please pay attention that the synchronizing device needs to have that driver capability:

driver current against $+U_B \ge n^*$ high-level/input impedance (n = number of sensors to be synchronized) driver current against $0V \ge n^*$ output current (n = number of sensors to be synchronized).

Refer to "General Notes Relating to Pepperl+Fuchs Product Information"

