

# Triangulation sensor (BGS) OBT650-R200-2EP-IO-0,3M-V31



- Medium design with versatile mounting options
- Best background suppressor in its class
- Precision object detection, almost irrespective of the color
- Extended temperature range -40 °C ... 60 °C
- High degree of protection IP69K
- IO-Link interface for service and process data

Triangulation sensor with background suppression











### **Function**


The optical sensors in the series are the first devices to offer an end-to-end solution in a medium-sized standard design - from the thru-beam sensor through to the measuring distance sensor. As a result of this design, the sensors are able to perform practically all standard automation


The entire series enables sensors to communicate via IO-Link.

The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

Multi Pixel Technology (MPT) ensures that the standard sensors are flexible and can be adapted to the application environment.

### **Dimensions**

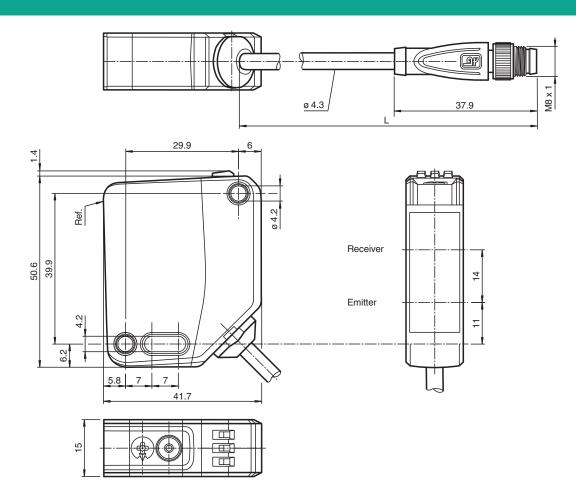



#### Technical Data **General specifications Detection range** 10 ... 650 mm Detection range min. 10 ... 100 mm Detection range max. 10 ... 650 mm Adjustment range 100 ... 650 mm Reference target standard white, 100 mm x 100 mm Light source modulated visible red light Light type LED risk group labelling exempt group Black-white difference (6 %/90 %) < 6 % at 650 mm Diameter of the light spot approx. 20 mm x 20 mm at a distance of 650 mm Opening angle approx. 2° Ambient light limit EN 60947-5-2: 70000 Lux Functional safety related parameters $\mathsf{MTTF}_\mathsf{d}$ 600 a Mission Time (T<sub>M</sub>) 20 a 0 % Diagnostic Coverage (DC) Indicators/operating means Operation indicator LED green: constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode Function indicator LED vellow: constantly on - object detected constantly off - object not detected Control elements Light-on/dark-on changeover switch Control elements Sensing range adjuster Electrical specifications Operating voltage $\mathsf{U}_\mathsf{B}$ 10 ... 30 V DC Ripple max. 10 % No-load supply current < 25 mA at 24 V supply voltage $I_0$ Protection class Interface Interface type IO-Link (via C/Q = pin 4) IO-Link revision Device profile Identification and diagnosis Smart Sensor type 2.4 Device ID 0x111601 (1119745) Transfer rate COM2 (38.4 kBit/s) Min. cycle time 2.3 ms Process data width Process data input 1 Bit Process data output 2 Bit SIO mode support ves Compatible master port type Α Output The switching type of the sensor is adjustable. The default setting is: C/Q - Pin4: NPN normally open / light-on, PNP normally closed / dark-on, IO-Link /Q - Pin2: NPN normally closed / dark-on, PNP normally open / light-on Switching type Signal output 2 push-pull (4 in 1) outputs, short-circuit protected, reverse polarity protected, overvoltage protected Switching voltage max, 30 V DC Switching current max. 100 mA, resistive load Usage category DC-12 and DC-13 ≤ 1.5 V DC Voltage drop $U_{\text{d}}$ Switching frequency f 500 Hz


Conformity

Response time

1 ms

Technical Data	
Technical Data	
Communication interface	IEC 61131-9
Product standard	EN 60947-5-2
Approvals and certificates	
UL approval	E87056, cULus Listed, class 2 power supply, type rating 1
CCC approval	CCC approval / marking not required for products rated ≤36 V
Ambient conditions	
Ambient temperature	-40 60 °C (-40 140 °F) , fixed cable -20 60 °C (-4 140 °F) , movable cable not appropriate for conveyor chains
Storage temperature	-40 70 °C (-40 158 °F)
Mechanical specifications	
Housing width	15 mm
Housing height	50.6 mm
Housing depth	41.7 mm
Degree of protection	IP67 / IP69 / IP69K
Connection	fixed cable 300 mm with M8 x 1 male connector; 4-pin
Material	
Housing	PC (Polycarbonate)
Optical face	PMMA
Mass	approx. 43 g
Cable length	0.3 m

# Connection




# **Connection Assignment**



Wire colors in accordance with EN 60947-5-2


1 | BN (brown) 2 | WH (white) 3 | BU (blue) 4 | BK (black)


### **Assembly**




1	Sensitivity adjustment	
2	Light-on / dark-on changeover switch	
3	Operating indicator / dark on	GN
4	Signal indicator	YE
5	Operating indicator / light on	GN

### **Characteristic Curve**

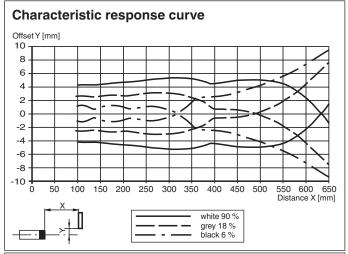

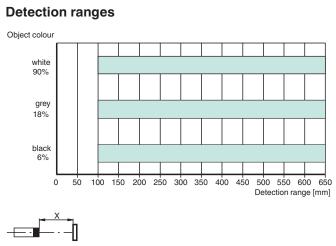

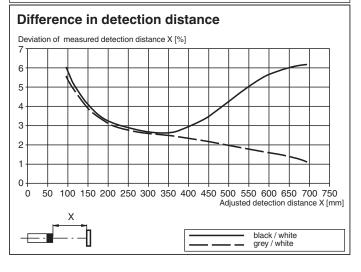

**Accessories** 

# OMH-MLV12-HWG Mounting bracket for series MLV12 sensors OMH-R200-01 Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm OMH-MLV12-HWK Mounting bracket for series MLV12 sensors OMH-R20x-Quick-Mount Quick mounting accessory ICE2-8IOL-G65L-V1D EtherNet/IP IO-Link master with 8 inputs/outputs ICE3-8IOL-G65L-V1D PROFINET IO IO-Link master with 8 inputs/outputs ICE2-8IOL-K45S-RJ45 EtherNet/IP IO-Link master with 8 inputs/outputs, DIN rail, screw terminal PROFINET IO IO-Link master with 8 inputs/outputs, DIN rail, push-in terminals ICE3-8IOL-K45P-RJ45 ICE3-8IOL-K45S-RJ45 PROFINET IO IO-Link master with 8 inputs/outputs, DIN rail, screw terminal IO-Link-Master02-USB IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection .... ICE1-8IOL-G30L-V1D Ethernet IO-Link module with 8 inputs/outputs ICE1-8IOL-G60L-V1D Ethernet IO-Link module with 8 inputs/outputs ICE2-8IOL-K45P-RJ45 EtherNet/IP IO-Link master with 8 inputs/outputs, DIN rail, push-in connectors V31-GM-2M-PUR Female cordset single-ended M8 straight A-coded, 4-pin, PUR cable grey V31-WM-2M-PUR Female cordset single-ended M8 angled A-coded, 4-pin, PUR cable grey

To unlock the adjustment functions, rotate the sensing range/sensitivity adjuster by more than 180°.

### Sensing Range/Sensitivity

To increase the sensing range/sensitivity, rotate the sensing range/sensitivity adjuster clockwise.

To reduce the sensing range/sensitivity, rotate the sensing range/sensitivity adjuster counter-clockwise.

As soon as the end of the adjustment range is reached, the signal indicator flashes at 8 Hz.

### Configuring Light On/Dark On

Press the light-on/dark-on changeover switch for more than 1 second (but less than 4 seconds). "Light on/dark on" mode changes and the relevant operating indicator lights up.

If you press the light-on/dark-on changeover switch for longer than 4 seconds, the "light on/dark on" mode will switch back to the original setting. The current status is activated when the light-on/dark-on changeover switch is released.

#### **Restoring Factory Settings**

Press the light-on/dark-on changeover switch for more than 10 seconds (but less than 30 seconds) until all LEDs go out. When the light-on/dark-on changeover switch is released, the signal indicator lights up. After 5 seconds, the sensor resumes operation with the factory settings.

The adjustment functions are locked after 5 minutes of inactivity. To unlock the adjustment functions, rotate the sensing range/sensitivity adjuster again by more than 180°.