

# Triangulation sensor (BGS) OBT650-R201-2EP-IO-V1



- Medium design with versatile mounting options
- Best background suppressor in its class
- Precision object detection, almost irrespective of the color
- Extended temperature range -40 °C ... 60 °C
- High degree of protection IP69K
- IO-Link interface for service and process data

Triangulation sensor with background suppression











#### **Function**


The optical sensors in the series are the first devices to offer an end-to-end solution in a medium-sized standard design – from the thru-beam sensor through to the measuring distance sensor. As a result of this design, the sensors are able to perform practically all standard automation

The entire series enables sensors to communicate via IO-Link.

The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

Multi Pixel Technology (MPT) ensures that the standard sensors are flexible and can be adapted to the application environment.

# **Dimensions**

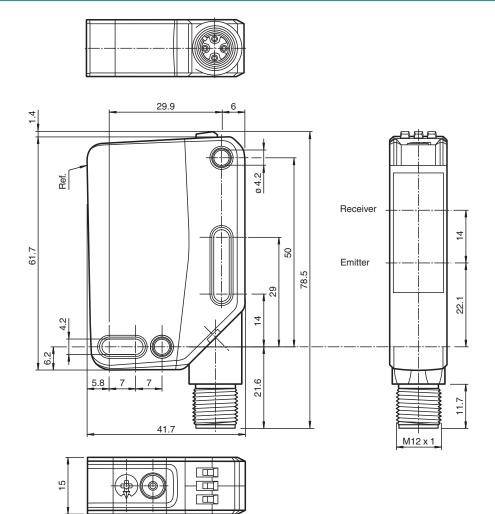


#### **Technical Data**

General specifications	
Detection range	10 650 mm
Detection range min.	10 100 mm
Detection range max.	10 650 mm
Adjustment range	100 650 mm
Reference target	standard white, 100 mm x 100 mm
Light source	LED
Light type	modulated visible red light
LED risk group labelling	exempt group
Black-white difference (6 %/90 %)	< 6 % at 650 mm
Diameter of the light spot	approx. 20 mm x 20 mm at a distance of 650 mm
Opening angle	approx. 2 °
Ambient light limit	EN 60947-5-2 : 70000 Lux
Functional safety related parameters	
MTTF <sub>d</sub>	600 a
Mission Time (T <sub>M</sub> )	20 a
Diagnostic Coverage (DC)	0 %
Indicators/operating means	
Operation indicator	LED green: constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode

Technical Data		
Function indicator		LED yellow: constantly on - object detected constantly off - object not detected
Control elements		Light-on/dark-on changeover switch
Control elements		Sensing range adjuster
Electrical specifications		
Operating voltage	$U_B$	10 30 V DC
Ripple		max. 10 %
No-load supply current	$I_0$	< 25 mA at 24 V supply voltage
Protection class		III
Interface		
Interface type		IO-Link ( via C/Q = pin 4 )
IO-Link revision		1.1
Device profile		Identification and diagnosis Smart Sensor type 2.4
Device ID		0x111611 (1119761)
Transfer rate		COM2 (38.4 kBit/s)
Min. cycle time		2.3 ms
Process data width		Process data input 1 Bit Process data output 2 Bit
SIO mode support		yes
Compatible master port type		A
Output		
Switching type		The switching type of the sensor is adjustable. The default setting is: C/Q - Pin4: NPN normally open / light-on, PNP normally closed / dark-on, IO-Link /Q - Pin2: NPN normally closed / dark-on, PNP normally open / light-on
Signal output		2 push-pull (4 in 1) outputs, short-circuit protected, reverse polarity protected, overvoltage protected
Switching voltage		max. 30 V DC
Switching current		max. 100 mA, resistive load
Usage category		DC-12 and DC-13
Voltage drop	$U_{\text{d}}$	≤ 1.5 V DC
Switching frequency	f	500 Hz
Response time		1 ms
Conformity		
Communication interface		IEC 61131-9
Product standard		EN 60947-5-2
Approvals and certificates		
UL approval		E87056 , cULus Listed , class 2 power supply , type rating 1
CCC approval		CCC approval / marking not required for products rated ≤36 V
Ambient conditions		
Ambient temperature		-40 60 °C (-40 140 °F)
Storage temperature		-40 70 °C (-40 158 °F)
Mechanical specifications		
Housing width		15 mm
Housing height		61.7 mm
Housing depth		41.7 mm
Degree of protection		IP67 / IP69 / IP69K
Connection		4-pin, M12 x 1 connector, 90° rotatable
Material		
Housing		PC (Polycarbonate)
Optical face		PMMA
Mass		approx. 47 g

**5**PEPPERL+FUCHS

## **Connection**




# **Connection Assignment**



Wire colors in accordance with EN 60947-5-2


1 BN (brown)
2 WH (white)
3 BU (blue)
4 BK (black)


#### **Assembly**

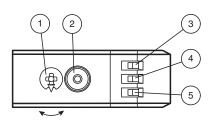


1	Sensitivity adjustment	
2	Light-on / dark-on changeover switch	
3	Operating indicator / dark on	GN
4	Signal indicator	YE
5	Operating indicator / light on	GN

## **Characteristic Curve**

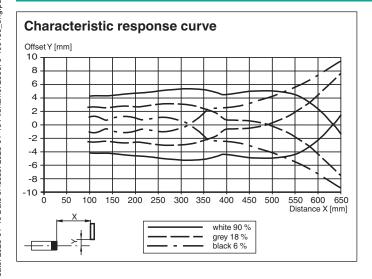

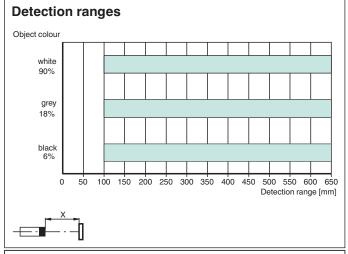

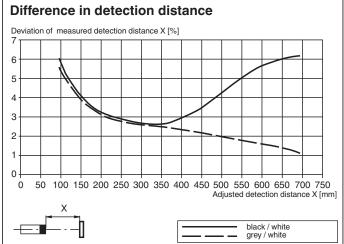

## **Accessories**

	OMH-RL31-02	Mounting bracket narrow
11	OMH-RL31-03	Mounting bracket narrow
5.0.	OMH-RL31-04	Mounting aid for round steel ø 12 mm or sheet 1.5 mm 3 mm
	OMH-RL31-07	Mounting bracket including adjustment
Ph-4 Ph-4	OMH-RL31-08	Mounting aid for round steel ø 12 mm or sheet 1.5 mm 3 mm
17	OMH-R20x-Quick-Mount	Quick mounting accessory
11-	ICE2-8IOL-G65L-V1D	EtherNet/IP IO-Link master with 8 inputs/outputs
110	ICE3-8IOL-G65L-V1D	PROFINET IO IO-Link master with 8 inputs/outputs

# **Accessories** ICE2-8IOL-K45S-RJ45 EtherNet/IP IO-Link master with 8 inputs/outputs, DIN rail, screw terminal ICE3-8IOL-K45P-RJ45 PROFINET IO IO-Link master with 8 inputs/outputs, DIN rail, push-in terminals ICE3-8IOL-K45S-RJ45 PROFINET IO IO-Link master with 8 inputs/outputs, DIN rail, screw terminal IO-Link-Master02-USB IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection ..... ICE1-8IOL-G30L-V1D Ethernet IO-Link module with 8 inputs/outputs ICE1-8IOL-G60L-V1D Ethernet IO-Link module with 8 inputs/outputs ICE2-8IOL-K45P-RJ45 EtherNet/IP IO-Link master with 8 inputs/outputs, DIN rail, push-in connectors V1-G-2M-PUR Female cordset single-ended M12 straight A-coded, 4-pin, PUR cable grey V1-W-2M-PUR Female cordset single-ended M12 angled A-coded, 4-pin, PUR cable grey

#### Sensing Range/Sensitivity

To increase the sensing range/sensitivity, rotate the sensing range/sensitivity adjuster clockwise.

To reduce the sensing range/sensitivity, rotate the sensing range/sensitivity adjuster counter-clockwise.

As soon as the end of the adjustment range is reached, the signal indicator flashes at 8 Hz.

#### Configuring Light On/Dark On

Press the light-on/dark-on changeover switch for more than 1 second (but less than 4 seconds). "Light on/dark on" mode changes and the relevant operating indicator lights up.

If you press the light-on/dark-on changeover switch for longer than 4 seconds, the "light on/dark on" mode will switch back to the original setting. The current status is activated when the light-on/dark-on changeover switch is released.

#### **Restoring Factory Settings**

Press the light-on/dark-on changeover switch for more than 10 seconds (but less than 30 seconds) until all LEDs go out. When the light-on/dark-on changeover switch is released, the signal indicator lights up. After 5 seconds, the sensor resumes operation with the factory settings.

The adjustment functions are locked after 5 minutes of inactivity. To unlock the adjustment functions, rotate the sensing range/sensitivity adjuster again by more than 180°.