

Triangulation sensor (BGE) OBT300-R200-2EP-IO-0,3M-V31-1T



- Medium design with versatile mounting options
- Secure and gapless detection, even near the surface through background evaluation
- Precision object detection, almost irrespective of the color
- Extended temperature range -40 °C ... 60 °Ċ
- High degree of protection IP69K
- IO-Link interface for service and process data

Triangulation sensor with background evaluation











Function


The optical sensors in the series are the first devices to offer an end-to-end solution in a medium-sized standard design - from the thru-beam sensor through to the measuring distance sensor. As a result of this design, the sensors are able to perform practically all standard automation

The entire series enables sensors to communicate via IO-Link.

The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

Multi Pixel Technology (MPT) ensures that the standard sensors are flexible and can be adapted to the application environment.

Dimensions

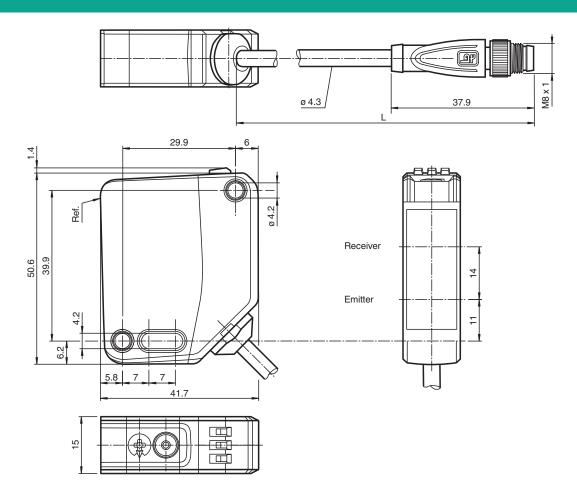




Technical Data **General specifications** Detection range 30 ... 300 mm Detection range min. 30 ... 80 mm Detection range max. 30 ... 300 mm Adjustment range 80 ... 300 mm Reference target standard white, 100 mm x 100 mm Light source modulated visible red light Light type LED risk group labelling exempt group Black-white difference (6 %/90 %) < 5 % at 300 mm Diameter of the light spot approx. 8 mm x 8 mm at a distance of 300 mm Opening angle approx. 1.5° Ambient light limit EN 60947-5-2: 70000 Lux Functional safety related parameters MTTF_d 600 a Mission Time (T_M) 20 a 0 % Diagnostic Coverage (DC) Indicators/operating means Operation indicator LED green: constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode Function indicator LED vellow: constantly on - background detected (object not detected) constantly off - object detected Control elements Light-on/dark-on changeover switch Control elements Sensing range adjuster **Electrical specifications** Operating voltage U_B 10 ... 30 V DC Ripple max. 10 % No-load supply current < 26 mA at 24 V supply voltage I_0 Protection class Interface Interface type IO-Link (via C/Q = pin 4) IO-Link revision Device profile Identification and diagnosis Smart Sensor type 2.4 Device ID 0x111702 (1120002) Transfer rate COM2 (38.4 kBit/s) Min. cycle time 2.3 ms Process data width Process data input 1 Bit Process data output 2 Bit SIO mode support ves Compatible master port type Α Output The switching type of the sensor is adjustable. The default setting is: C/Q - Pin4: NPN normally open / dark-on, PNP normally closed / light-on, IO-Link /Q - Pin2: NPN normally closed / light-on, PNP normally open / dark-on Switching type Signal output 2 push-pull (4 in 1) outputs, short-circuit protected, reverse polarity protected, overvoltage protected Switching voltage max, 30 V DC Switching current max. 100 mA, resistive load Usage category DC-12 and DC-13 ≤ 1.5 V DC Voltage drop U_{d} Switching frequency f 500 Hz Response time 1 ms Conformity

Technical Data	
Communication intento	IEO 04404 0
Communication interface	IEC 61131-9
Product standard	EN 60947-5-2
Approvals and certificates	
UL approval	E87056, cULus Listed, class 2 power supply, type rating 1
CCC approval	CCC approval / marking not required for products rated ≤36 V
Ambient conditions	
Ambient temperature	-40 60 °C (-40 140 °F) , fixed cable -20 60 °C (-4 140 °F) , movable cable not appropriate for conveyor chains
Storage temperature	-40 70 °C (-40 158 °F)
Mechanical specifications	
Housing width	15 mm
Housing height	50.6 mm
Housing depth	41.7 mm
Degree of protection	IP67 / IP69 / IP69K
Connection	fixed cable 300 mm with M8 x 1 male connector; 4-pin
Material	
Housing	PC (Polycarbonate)
Optical face	PMMA
Mass	approx. 43 g
Cable length	0.3 m

Connection




Connection Assignment




Wire colors in accordance with EN 60947-5-2

1 | BN (brown) 2 | WH (white) 3 | BU (blue) 4 | BK (black)



1	Sensitivity adjustment	
2	Light-on / dark-on changeover switch	
3	Operating indicator / dark on	
4	Signal indicator	
5	Operating indicator / light on	GN

Minimum object height (typical)

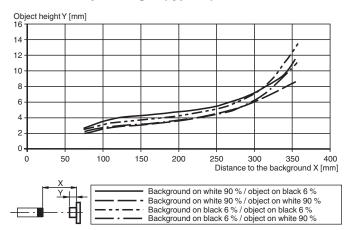

Accessories

6/	V31-GM-2M-PUR	Female cordset single-ended M8 straight A-coded, 4-pin, PUR cable grey
6/	V31-WM-2M-PUR	Female cordset single-ended M8 angled A-coded, 4-pin, PUR cable grey
	OMH-MLV12-HWG	Mounting bracket for series MLV12 sensors
Ball of the state of	OMH-R200-01	Mounting aid for round steel ø 12 mm or sheet 1.5 mm 3 mm
	OMH-MLV12-HWK	Mounting bracket for series MLV12 sensors
7	OMH-R20x-Quick-Mount	Quick mounting accessory
11-	ICE2-8IOL-G65L-V1D	EtherNet/IP IO-Link master with 8 inputs/outputs
110	ICE3-8IOL-G65L-V1D	PROFINET IO IO-Link master with 8 inputs/outputs
	ICE2-8IOL-K45S-RJ45	EtherNet/IP IO-Link master with 8 inputs/outputs, DIN rail, screw terminal
	ICE3-8IOL-K45P-RJ45	PROFINET IO IO-Link master with 8 inputs/outputs, DIN rail, push-in terminals
8	ICE3-8IOL-K45S-RJ45	PROFINET IO IO-Link master with 8 inputs/outputs, DIN rail, screw terminal

Accessories IO-Link-Master02-USB IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection ICE1-8IOL-G30L-V1D Ethernet IO-Link module with 8 inputs/outputs ICE1-8IOL-G60L-V1D Ethernet IO-Link module with 8 inputs/outputs ICE2-8IOL-K45P-RJ45 EtherNet/IP IO-Link master with 8 inputs/outputs, DIN rail, push-in connectors

Configuration

To unlock the adjustment functions, rotate the sensing range/sensitivity adjuster by more than 180°.

Sensing Range/Sensitivity

To increase the sensing range/sensitivity, rotate the sensing range/sensitivity adjuster clockwise.

To reduce the sensing range/sensitivity, rotate the sensing range/sensitivity adjuster counter-clockwise.

As soon as the end of the adjustment range is reached, the signal indicator flashes at 8 Hz.

Configuring Light On/Dark On

Press the light-on/dark-on changeover switch for more than 1 second (but less than 4 seconds). "Light on/dark on" mode changes and the relevant operating indicator lights up.

If you press the light-on/dark-on changeover switch for longer than 4 seconds, the "light on/dark on" mode will switch back to the original setting. The current status is activated when the light-on/dark-on changeover switch is released.

Restoring Factory Settings

Press the light-on/dark-on changeover switch for more than 10 seconds (but less than 30 seconds) until all LEDs go out. When the light-on/dark-on changeover switch is released, the signal indicator lights up. After 5 seconds, the sensor resumes operation with the factory settings.

The adjustment functions are locked after 5 minutes of inactivity. To unlock the adjustment functions, rotate the sensing range/sensitivity adjuster again by more than 180°.