

Triangulation sensor (BGE) OBT600-R200-EP-IO-0,3M-V3-1T-L



- Medium design with versatile mounting options
- Secure and gapless detection, even near the surface through background evaluation
- DuraBeam Laser Sensors durable and employable like an LED
- Extended temperature range -40 °C ... 60 °Ċ
- High degree of protection IP69K
- IO-Link interface for service and process data

Laser diffuse mode sensor with background evaluation











Function


The optical sensors in the series are the first devices to offer an end-to-end solution in a medium-sized standard design - from the thru-beam sensor through to the measuring distance sensor. As a result of this design, the sensors are able to perform practically all standard automation

The entire series enables sensors to communicate via IO-Link.

The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.


Multi Pixel Technology (MPT) ensures that the standard sensors are flexible and can be adapted to the application environment.

Dimensions

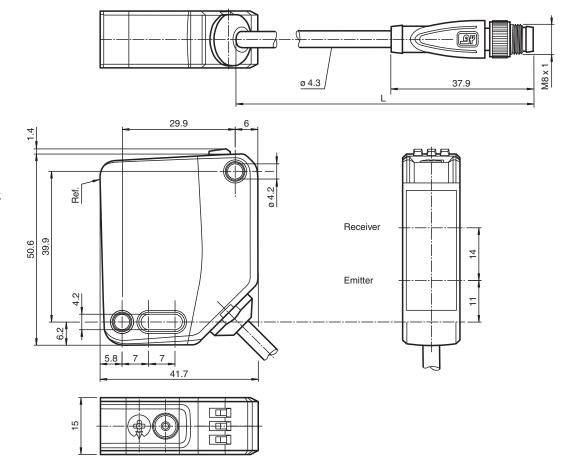




Technical Data **General specifications Detection range** 40 ... 600 mm Detection range min. 40 ... 90 mm Detection range max. 40 ... 600 mm Adjustment range 90 ... 600 mm Reference target standard white, 100 mm x 100 mm Light source laser diode modulated visible red light Light type Laser nominal ratings LASER LIGHT, DO NOT STARE INTO BEAM Note Laser class Wave length 680 nm Beam divergence > 5 mrad, d63 < 2,8 mm in the range of 350 mm ... 800 mm Pulse length Repetition rate approx. 13 kHz max. pulse energy 10.4 nJ < 5 % at 300 mm Black-white difference (6 %/90 %) Diameter of the light spot approx. 2.5 mm at a distance of 600 mm Opening angle approx. 0.3° Ambient light limit EN 60947-5-2: 70000 Lux Functional safety related parameters MTTF_d 560 a Mission Time (T_M) 20 a Diagnostic Coverage (DC) 0 % Indicators/operating means Operation indicator LED green: constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode Function indicator LED vellow: constantly on - background detected (object not detected) constantly off - object detected Control elements Light-on/dark-on changeover switch Control elements Sensing range adjuster **Electrical specifications** Operating voltage U_{B} 10 ... 30 V DC Ripple max. 10 % < 15 mA at 24 V supply voltage No-load supply current I_0 Protection class Interface Interface type IO-Link (via C/Q = pin 4) IO-Link revision Identification and diagnosis Device profile Smart Sensor type 2.4 Device ID 0x111703 (1120003) Transfer rate COM2 (38.4 kBit/s) Min. cycle time 2.3 ms Process data width Process data input 1 Bit Process data output 2 Bit SIO mode support yes Compatible master port type Output The switching type of the sensor is adjustable. The default setting is: C/Q - Pin4: NPN normally open / dark-on, PNP normally closed / light-on, IO-Link Switching type Signal output 1 push-pull (4 in 1) output, short-circuit protected, reverse polarity protected, overvoltage protected



Technical Data		
i ecimicai bata		
Switching voltage		max. 30 V DC
Switching current		max. 100 mA , resistive load
Usage category		DC-12 and DC-13
Voltage drop	U_{d}	≤ 1.5 V DC
Switching frequency	f	1650 Hz
Response time		300 μs
Conformity		
Communication interface		IEC 61131-9
Product standard		EN 60947-5-2
Laser safety		EN 60825-1:2014
Approvals and certificates		
UL approval		E87056, cULus Listed, class 2 power supply, type rating 1
CCC approval		CCC approval / marking not required for products rated ≤36 V
FDA approval		IEC 60825-1:2014 Complies with 21 CFR 1040.10 and 1040.11 except for conformance with IEC 60825-1 Ed. 3 as described in Laser Notice 56, dated May 8, 2019.
Ambient conditions		
Ambient temperature		-40 60 °C (-40 140 °F) , cable, fixed installation -20 60 °C (-4 140 °F) , movable cable not appropriate for conveyor chains
Storage temperature		-40 70 °C (-40 158 °F)
Mechanical specifications		
Degree of protection		IP67 / IP69 / IP69K
Connection		300 mm fixed cable with M8 x 1, 3-pin connector
Material		
Housing		PC (Polycarbonate)
Optical face		PMMA
Mass		approx. 43 g
Dimensions		
Height		50.6 mm
Width		15 mm
Depth		41.7 mm
Cable length		0.3 m

Connection




Connection Assignment



Wire colors in accordance with EN 60947-5-2

1 | BN (brown) 3 | BU (blue) 4 | BK (black)


Assembly



1	Sensitivity adjustment	
2	Light-on / dark-on changeover switch	
3	Operating indicator / dark on	GN
4	Signal indicator	YE
5	Operating indicator / light on	GN

Characteristic Curve

Minimum object height (typical)

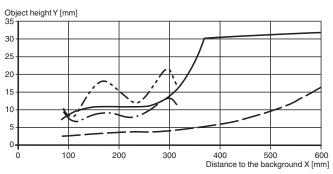





CLASS 1 LASER PRODUCT

IEC 60825-1: 2007 certified. Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50, dated June 24, 2007

CLASS 1 LASER PRODUCT

IEC 60825-1: 2007 certified.
Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50, dated June 24, 2007

To unlock the adjustment functions, rotate the sensing range/sensitivity adjuster by more than 180°.

Sensing Range/Sensitivity

To increase the sensing range/sensitivity, rotate the sensing range/sensitivity adjuster clockwise.

To reduce the sensing range/sensitivity, rotate the sensing range/sensitivity adjuster counter-clockwise.

As soon as the end of the adjustment range is reached, the signal indicator flashes at 8 Hz.

Configuring Light On/Dark On

Press the light-on/dark-on changeover switch for more than 1 second (but less than 4 seconds). "Light on/dark on" mode changes and the relevant operating indicator lights up.

If you press the light-on/dark-on changeover switch for longer than 4 seconds, the "light on/dark on" mode will switch back to the original setting. The current status is activated when the light-on/dark-on changeover switch is released.

Restoring Factory Settings

Press the light-on/dark-on changeover switch for more than 10 seconds (but less than 30 seconds) until all LEDs go out. When the light-on/dark-on changeover switch is released, the signal indicator lights up. After 5 seconds, the sensor resumes operation with the factory settings.

The adjustment functions are locked after 5 minutes of inactivity. To unlock the adjustment functions, rotate the sensing range/sensitivity adjuster again by more than 180°.