

Triangulation sensor (BGS) OBT350-R101-2EP-IO-0,3M-V31



- Miniature design with versatile mounting options
- Best background suppressor in its class
- Precision object detection, almost irrespective of the color
- Extended temperature range -40 °C ... 60 °Ċ
- High degree of protection IP69K
- IO-Link interface for service and process data

Triangulation sensor with background suppression












Function


The miniature optical sensors are the first devices of their kind to offer an end-to- end solution in a small single standard design — from thru-beam sensor through to a distance measurement device. As a result of this design, the sensors are able to perform practically all standard automation


The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

The use of Multi Pixel Technology gives the standard sensors a high level of flexibility and enables them to adapt more effectively to their operating environment.

Dimensions

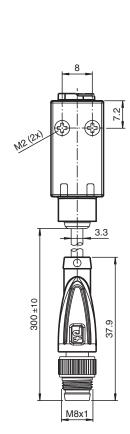

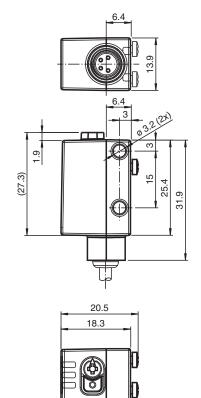

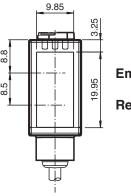

Emitter

Receiver

Release date: 2023-03-28 Date of issue: 2023-03-28 Filename: 267075-0066_eng.pdf


Technical Data

General specifications		
Detection range		5 350 mm
Detection range min.		5 25 mm
Detection range max.		5 350 mm
Adjustment range		25 350 mm
Reference target		standard white, 100 mm x 100 mm
Light source		LED
Light type		modulated visible red light
LED risk group labelling		exempt group
Black-white difference (6 %/90 %)		< 15 % at 350 mm
Diameter of the light spot		approx. 20 mm at a distance of 350 mm
Opening angle		approx. 3°
Ambient light limit		EN 60947-5-2 : 40000 Lux
Functional safety related parameters		
MTTF _d		600 a
Mission Time (T _M)		20 a
Diagnostic Coverage (DC)		0 %
Indicators/operating means		
Operation indicator		LED green: constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode
Function indicator		LED yellow: constantly on - object detected constantly off - object not detected
Control elements		Light-on/dark-on changeover switch
Control elements		Sensing range adjuster
Electrical specifications		
Operating voltage	U_B	10 30 V DC
Ripple		max. 10 %
No-load supply current	I_0	< 25 mA at 24 V supply voltage
Protection class		III
Interface		
Interface type		IO-Link (via $C/Q = pin 4$)
IO-Link revision		1.1
Device profile		Smart Sensor
Device ID		0x110601 (1115649)
Transfer rate		COM2 (38.4 kBit/s)
Min. cycle time		2.3 ms
Process data width		Process data input 1 Bit Process data output 2 Bit
SIO mode support		yes
Compatible master port type		A
Output		
Switching type		The switching type of the sensor is adjustable. The default setting is: C/Q - Pin4: NPN normally open / light-on, PNP normally closed / dark-on, IO-Link /Q - Pin2: NPN normally closed / dark-on, PNP normally open / light-on
Signal output		2 push-pull (4 in 1) outputs, short-circuit protected, reverse polarity protected, overvoltage protected
Switching voltage		max. 30 V DC
Switching current		max. 100 mA, resistive load
Usage category		DC-12 and DC-13
Voltage drop	U_{d}	≤ 1.5 V DC
Switching frequency	f	500 Hz
Response time		1 ms
Conformity		

ŧ	
2	
2	
ā	
cc	
ů	
٤	
5	
1	
7	
G	
?	١
ď	
ž	
č	
٩	
Ш	
ά	
23	
7	
C	
8	
9	
ű	
4	
9	
4	
č	
α	
õ	
ď	
9	
23	
Ċ	֡
٥.	
4	
ď	
4	
ŭ	
ď	
4	
ď	

Technical Data	
Communication interface	IEC 61131-9
Product standard	EN 60947-5-2
Approvals and certificates	
UL approval	E87056, cULus Listed, class 2 power supply, type rating 1
Ambient conditions	
Ambient temperature	-40 60 °C (-40 140 °F) , fixed cable -25 60 °C (-13 140 °F) , movable cable not appropriate for conveyor chains
Storage temperature	-40 70 °C (-40 158 °F)
Mechanical specifications	
Housing width	13.9 mm
Housing height	33.8 mm
Housing depth	18.3 mm
Degree of protection	IP67 / IP69 / IP69K
Connection	fixed cable 300 mm with M8 x 1 male connector; 4-pin
Material	
Housing	PC (Polycarbonate)
Optical face	PMMA
Mass	approx. 17 g
Cable length	0.3 m

Connection

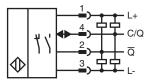


Connection Assignment



Wire colors in accordance with EN 60947-5-2


1	BN	(browr
2	WH	(white)
3	BU	(blue)
4	BK	(black)


Assembly

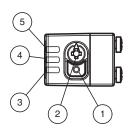


- 1 Light-on/dark-on changeover switch
- 2 Sensing range adjuster
- 3 Operating indicator / dark on
- 4 Signal indicator
- 5 Operating indicator / light on

Characteristic Curve

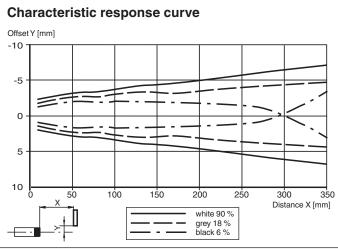

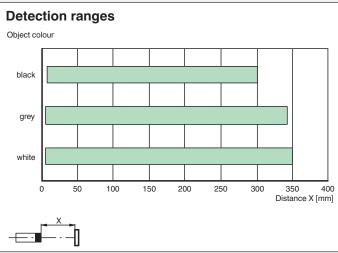

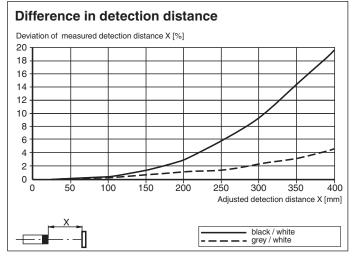

Accessories				
	ICE2-8IOL-G65L-V1D	EtherNet/IP IO-Link master with 8 inputs/outputs		
11-				
11-0	ICE3-8IOL-G65L-V1D	PROFINET IO IO-Link master with 8 inputs/outputs		
	ICE1-8IOL-G30L-V1D	Ethernet IO-Link module with 8 inputs/outputs		
0 10 0 10 0 10 0 10 0 10 0 10 0 10	ICE1-8IOL-G60L-V1D	Ethernet IO-Link module with 8 inputs/outputs		
	ICE2-8IOL-K45P-RJ45	EtherNet/IP IO-Link master with 8 inputs/outputs, DIN rail, push-in connectors		
9	ICE2-8IOL-K45S-RJ45	EtherNet/IP IO-Link master with 8 inputs/outputs, DIN rail, screw terminal		
	ICE3-8IOL-K45P-RJ45	PROFINET IO IO-Link master with 8 inputs/outputs, DIN rail, push-in terminals		
9.	ICE3-8IOL-K45S-RJ45	PROFINET IO IO-Link master with 8 inputs/outputs, DIN rail, screw terminal		
C. C	IO-Link-Master02-USB	IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection		
6/	V31-GM-2M-PUR	Female cordset single-ended M8 straight A-coded, 4-pin, PUR cable grey		
6/	V31-WM-2M-PUR	Female cordset single-ended M8 angled A-coded, 4-pin, PUR cable grey		

- 1 Light on / dark on changeover switch
- 2 Sensing range / sensitivity adjuster
- 3 Operating indicator / dark on
- 4 Signal indicator
- 5 Operating indicator / light on

To unlock the adjustment functions turn the sensing range adjuster for more than 180 degrees.

Sensing Range / Sensitivity

Turn sensing range / sensitivity adjuster clockwise to increase sensing range / sensitivity.

Turn sensing range /sensitivity adjuster counterclockwise to decrease sensing range / sensitivity.

If the end of the adjustment range is reached, the signal indicator starts flashing with 8 Hz.

Light on / Dark on Configuration

Press the light on / dark on changeover switch for more than 1 second (less than 4 seconds). The light on / dark on mode changes and the operating indicators are activated accordingly.

If you press the light on / dark on changeover switch for more than 4 seconds, the light on / dark on mode changes back to the original setting. On release of the light on / dark on changeover switch the current state is activated.

Restore Factory Settings

Press the light on / dark on changeover switch for more than 10 seconds (less than 30 seconds) until all LEDs turn off. On release of the light on / dark on changeover switch the signal indicator turns on. After 5 seconds the sensor resumes operation with factory settings.

After 5 minutes of inactivity the sensing range / sensitivity adjustment is locked. In order to reactivate the sensing range / sensitivity adjustment, turn the sensing range / sensitivity adjuster for more than 180 degrees.