





 ϵ



Model Number

SBL-8-H-900-IR-SL-V-3928

Background suppression sensor with 4-pin, M12 x 1 connector and fixed cable with 4-pin, M12 socket

Features

- Background suppression sensor for roller conveyors
- For installation between the rollers on a roller conveyor
- Very small black-white difference
- Adjustable detection range
- · Can be connected in series
- 3 in 1: Sensor, pneumatic valve and integrated control logic


Product information

Sensors of the SBL series are used to easily control material flow on roller conveyors in material handling and other branches.


The SBL series is a precise background suppression sensor according to the 3 element method. The sensor features superior background suppression and a very good ambient light immunity. Material and transport container of all colors and opacities are reliably detected.

The special design allows the sensor to be mounted between the rollers of a roller conveyor or any other conveying unit. Mounting between the rollers is easy and protects the sensor.

Dimensions

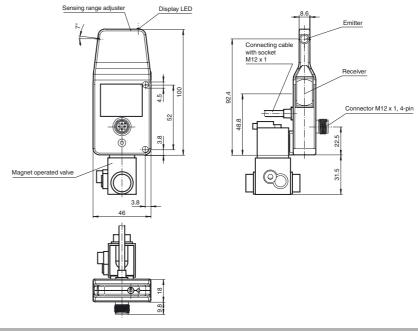

Electrical connection

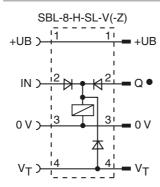


O = Light on

= Dark on

Pinout



Indicators/operating means



1 Signal display yellow2 Sensing range adjuster

Technical data		
General specifications		
Detection range		40 900 mm
Detection range min.		40 340 mm
Detection range max.		40 900 mm
Adjustment range		340 900 mm
Reference target		standard white 200 mm x 200 mm
Light source		IRED
Light type		modulated infrared light , 880 nm
Black/White difference (6 %/90 %	ر.	< 10 %
Diameter of the light spot		approx. 60 mm at detection range 900 mm
Cascadability		At 20°C:
		max. 38 sensors per line
Ambient light limit		continuous light 30000 Lux, Fluorescent lamp 5000 Lux
Functional safety related param	eters	
MTTF _d		1100 a
Mission Time (T _M)		20 a
Diagnostic Coverage (DC)		0 %
Indicators/operating means		
Function indicator		LED yellow: lights when object is detected
Control elements		Sensing range adjuster
Electrical specifications		
Operating voltage	U _B	24 V DC ± 20 %
Ripple		max. 10 %
No-load supply current	Io	max. 115 mA
Output	Ü	
Switching type		dark on
Signal output		1 PNP, short-circuit protected, reverse polarity protected
Switching voltage		max. 30 V DC
Switching current		max. 200 mA
Switching frequency	f	100 Hz
Response time		5 ms
Pneumatic output		3/2 way valve
Type of valve		currentless closed
Operating pressure		4 7 bar (58 101.5 psi)
Medium		air
Conformity		
Product standard		EN 60947-5-2
Ambient conditions		214 000 11 0 2
Ambient temperature		-15 50 °C (5 122 °F)
•		-30 60 °C (-22 140 °F)
Storage temperature		-30 60 C (-22 140 F)
Mechanical specifications		40
Housing width		18 mm
Housing height		100 mm
Housing depth		46 mm
Degree of protection		IP65
Connection		4-pin, M12 x 1 connector; Connecting cable with Socket, straight M12 x 1; Length: 1930 mm
Material		Straight W12 X 1 , Longui. 1000 mm
Housing		plastic
Optical face		plastic lens
Mass		approx. 200 g
Compliance with standards and		арргох. 200 у
directives		
Standard conformity		IEO (EN 00000 L. III 40 13/3/ LT
		IEC / EN 60068. half-sine, 40 g in each X, Y and Z directions
Shock and impact resistance		IEC / EN 60068-2-6. Sinus. 10 -1000 Hz, 10 g in each X, Y and 2
Shock and impact resistance Vibration resistance		directions
Vibration resistance		directions
Vibration resistance Approvals and certificates		
Vibration resistance		directions cULus Listed, Class 2 Power Source, Type 1 enclosure CCC approval / marking not required for products rated ≤36 V

Accessories

OMH-SBL-01

Mounting bracket for sensors of SBL series

V1-G-2M-PVC

Female cordset, M12, 4-pin, PVC cable

V1-G-5M-PVC

Female cordset, M12, 4-pin, PVC cable

V1-W-2M-PUR

Female cordset, M12, 4-pin, PUR cable

V1-W-5M-PUR

Female cordset, M12, 4-pin, PUR cable

V1S-TEE-V1/V1S

T-Distributor, M12 connector to M12 socket/connector


Schraubendreher 0,5 x 3,0 mm


Screwdriver

Additional accessories can be found in the Internet.

Curves/Diagrams

Difference in detection distance

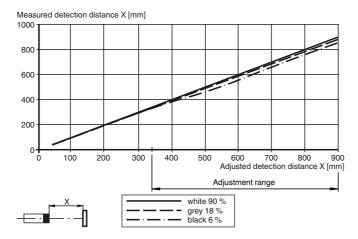

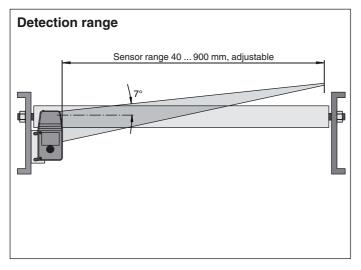

Options:

Sensors with the **version -V** are equipped with a solenoid valve and can directly control a 3/2 way pneumatic actuator, without any-interaction of an external system controlling unit (PLC). As soon as conveyed goods are detected, the diffuse mode sensor gives an electrical-signal to the pneumatic solenoid valve, which is then activated.

Sensors with the control logic **option -SL-(V)** allows up to 50 diffuse mode sensors to be connected-to each other (data and power), depending on the current consumption of sensor and solenoid valve. An additional supply power and data bus cable is used to interconnect the sensors with control logic option -SL. All necessary functions for controlling the material flow of conveyed goods are supported, such as: single feed, single release, slug release, external motor and solenoid valve control. It is also possible to energize the valves of all sensors included in the cascade by slug release (VT). To do this, apply the positive supply voltage (+UB) on the input VT of the first sensor.

Sensors with timing **function -Z** features the adjustment of the ON- and OFF delay of the output independently. This optimizes control of the solenoid valve. A zero pressure accumulation of the conveyed goods can be realized with application of time ON- and OFF delay of the output. The ON- and OFF delay to control the switching of the solenoid valve may be adjusted between 0 and 2 seconds.

Additional power supply between every 20 to 25 sensors can be realized by the use of the power in feed junction V1S-TEE-V1/V1S in combination with a cable V1-G-...-PVC. This features to practically connect any number of SBL sensors in series. Attention should be paid to the maximum rated current of the cable and the connectors which usually is max. I = 4 A. For more details on the maximum rated current of single components, please refer to our datasheet values. For the electrical supply of the sensors the country specific standards have to be considered.

Note:

Use a screwdriver to adjust the sensing range. We strongly recommend to use the screwdriver given in the accessories section.